



BT SHELL MILL ADAPTERS

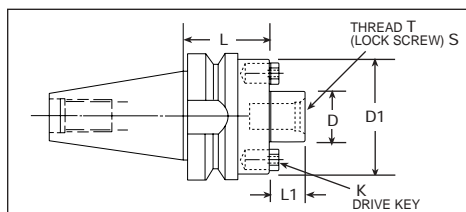

BT 40	Part No.	D	D1	L	L1	K	T	S
	B40SM0750	0.75	1.75	1.375	0.68	0.31	3/8 - 24	C5002
	B40SM1000	1.00	2.25	2.06	0.68	0.38	1/2 - 20	C5003
	B40SM1250	1.25	2.75	2.12	0.68	0.50	5/8 - 18	C5004
	B40SM1500	1.50	3.75	2.40	0.94	0.62	3/4 - 16	C5005

BT 50	Part No.	D	D1	L	L1	K	T	S
	B50SM0750	0.75	1.75	2.00	0.68	0.31	3/8 - 24	C5002
	B50SM1000	1.00	2.25	2.00	0.68	0.38	1/2 - 20	C5003
	B50SM1250	1.25	2.75	2.00	0.68	0.50	5/8 - 18	C5004
	B50SM1500	1.50	3.75	2.40	0.94	0.62	3/4 - 16	C5005
	B50SM2000	2.00	4.88	2.40	0.94	0.75	1" - 14	C5006
	B50SM2500	2.50	4.88	2.40	1.125	1.00	1" - 14	C5007

BT MORSE TAPER ADAPTERS

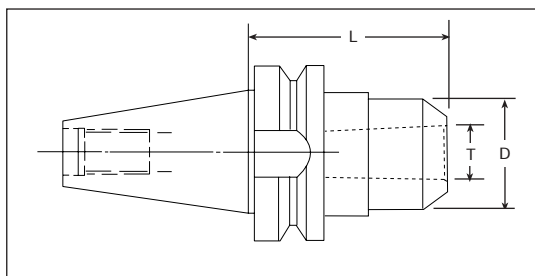

BT 40	Part No.	T Taper	D	L
	B40MT2	2	2.38	1.25
	B40MT3	3	3.06	1.62
	B40MT4	4	3.94	2.00

BT 50	Part No.	T Taper	D	L
	B50MT2	2	1.50	1.25
	B50MT3	3	2.31	1.62
	B50MT4	4	3.18	2.00
	B50MT5	5	4.75	2.75